

## **URGENT Field Safety Notification**

HeartStart Intrepid Monitor/Defibrillator (867172)
Intermittent ECG Waveforms

#### 01-JULY-2024

# This document contains important information for the continued safe and proper use of your equipment.

Please review the following information with all members of your staff who need to be aware of the contents of this communication. It is important to understand the implications of this communication.

Please retain a copy of this letter with your device's Instructions for Use.


#### Dear Valued Customer,

Philips has become aware of a potential safety issue where the HeartStart Intrepid Monitor/Defibrillator may display intermittent ECG waveforms when the fourth limb lead is placed on the patient using either a 5-Lead or 10-Lead ECG cable. This URGENT Field Safety Notice is intended to inform you about:

#### 1. What the problem is and under what circumstances it can occur

When monitoring ECG using either a 5-Lead or 10-Lead ECG cable, the HeartStart Intrepid Monitor/Defibrillator may display intermittent ECG waveforms when the fourth limb lead is placed on the patient. The ECG tracing is normal when only three limb leads are connected (right arm, left arm, and left leg). However, when there are one or more poor ECG lead connections to the patient, the ECG tracing either displays a dashed line or is intermittent between waveform and dashed line (see Figures 1-3 below). This failure may occur any time the HeartStart Intrepid Monitor/Defibrillator is being used to monitor 5-Lead or 12-Lead ECG.

Figure 1 - 12-Lead ECG

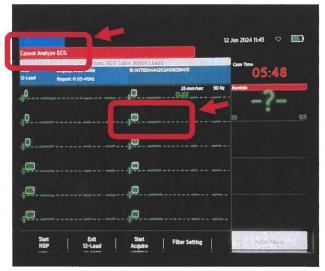

The ECG tracing is intermittent between waveform and dashed line.



Figure 2 - Monitor mode



The ECG tracing is intermittent between waveform and dashed line.

Figure 3 - ECG printout

The ECG tracing is intermittent between waveform and dashed line.



The issue was identified due to customer complaints.

The HeartStart Intrepid is a monitor/defibrillator used in an emergency medical services or hospital environment by qualified medical personnel trained in its operation to provide pacing, defibrillation, and synchronized cardioversion therapies. It is intended to measure heart rate and rhythm; blood oxygen saturation; exhaled CO2; systolic, diastolic, and mean blood pressure; and temperature.

#### 2. Hazard/harm associated with the issue

A failure to capture an ECG signal prevents Advanced Life Support (ALS) users from interpreting the cardiac rhythm (ECG) to determine the need for medical interventions or defibrillation therapy. The issue can occur in monitoring mode or using one of the following therapeutic modes of defibrillation therapy: Manual, Synchronized Cardioversion, or Pacing. The potential harms include: delays in assessing patient condition and possible delayed treatment.

#### 3. Affected products and how to identify them

All HeartStart Intrepid Monitor/Defibrillators may be affected by this issue. The issue is more likely to occur in devices with the 12-Lead (B03) option. HeartStart Intrepid Monitor/Defibrillators can be identified by model number 867172 printed on the primary label on the bottom of the device. HeartStart Intrepid Monitor/Defibrillators with the 12-Lead (B03) option can be identified as shown below:

Label Description	Label Sample	Remarks
Device Regulatory label	Rev C:    Phillips	Confirm code "B03" is listed in OPT box or device has 867294 field upgrade label.
	Rev D:  PHILIPS  Monitor/Defibrillator  REF 867172  Madd HeartStat Jan 2d  Device Weight 6 7 kg  Power 100V-240V-, Soltz/80Hz 18-0 75A  Physics Goldway (Sherzhen) Industrial Inc.  No 2 Kei North 2rd Road, Narishan Delinct, 510057, Shenzhen PEOPLE'S REPUBLIC OF CHINA  Lee   Juni Shangha International Holding Corp SmbHtEurope)  Tel 0049-40-2513175  Fox: 0049-40-255726  Legisland Shangha Physics   Fox: 0049-40-255726  Tel 0049-40-2513175  RESISSANTIR Rand	For Rev D label confirm "B03" shown on Device Primary Label (UDI) or has an 867294 upgrade label.
Device Primary Label (UDI)	REF Service# XXX  SH CNYWWXXXXX  (OPT REF) XXX  OPT BEAL YYYY-GMM-OD  XXXX	Confirm code "B03" is listed in OPT box or device has 867294 field upgrade label.
Field Upgrade Label	REF 867294	Confirm code "B03" is listed in OPT box or device has 867294 field upgrade label.

#### 4. Actions that should be taken by the customer / user in order to prevent risks for patients or users

If you follow the Instructions for Use (IFU) and take the following precautions, you can continue to use your HeartStart Intrepid Monitor/Defibrillator:

- Should you experience gaps in the ECG waveform, removal of the Right Leg and Chest connections will
  force the device to default to 3-Lead measurement and ensure a continuous ECG during monitoring,
  pacing, or cardioversion.
- Continue to follow the Instructions for Use (IFU) for proper use of ECG electrodes and their application
  to patients, including skin preparation. Use only Philips approved lead sets listed in the IFU with the
  HeartStart Intrepid. Failure to do so may introduce noise and result in intermittent 'Cannot Analyze' or
  'Leads on/Leads off' ECG messages.
- Use only Philips monitoring electrodes, multifunction electrode pads, battery, and accessories listed in the IFU. Substitutions may cause the HeartStart Intrepid to function improperly and cause patient injury.
- Keep a copy of this Urgent Field Safety Notification letter with your device's Instructions for Use until you receive the correction.
- Complete and return the Urgent Field Safety Notice Response Form included with this letter.



Complete and return the Urgent Field Safety Notification response form included within 30 days of receipt. Please pass this notice on to all those who need to be aware within your organization or to any organization where the potentially affected devices have been transferred (if appropriate).

### 5. Actions planned by Philips Emergency Care (CN-MF-000003921) to correct the problem

While a solution for this issue is in development, Philips is providing this Urgent Field Safety Notice to inform affected customers. Philips will notify you again to arrange a permanent resolution immediately upon release. Philips anticipates that the solution will be available in Q4 2024.

If you need any further information or support concerning this issue, please contact your local Philips representative. < Key Markets insert contact information here >

This notice has been reported to the appropriate Regulatory Agencies. Be sure to report any occurrence of this issue to Philips, your Philips representative, or your local Regulatory authority.

Philips regrets any inconvenience caused by this problem.

Sincerely,

Tanya DeSchmidt
Director of Quality

Tony She Sr. QMS Manager Document Identification: FSN-2024-CC-EC-016



### **URGENT FIELD SAFETY NOTIFICATION RESPONSE FORM**

**Reference:** HeartStart Intrepid Monitor/Defibrillator (867172) Intermittent ECG Waveform **Instructions:** Please complete and return this form to Philips promptly and no later than 30 days from receipt. Completing this form confirms receipt of the Field Safety Notification and understanding of the issue and required actions to be taken.

Customer / Consignee / Facility Name:	
Street Address:	
City / State / Zip / Country:	

#### **Customer Actions:**

If you follow the Instructions for Use (IFU) and take the following precautions, you may continue to use your HeartStart Intrepid Monitor/Defibrillator:

- Should you experience gaps in the ECG waveform, removal of the Right Leg and Chest connections will
  force the device to default to 3-Lead measurement and ensure a continuous ECG during monitoring,
  pacing, or cardioversion.
- Continue to follow the Instructions for Use (IFU) for proper use of ECG electrodes and their application
  to patients, including skin preparation. Use only Philips approved lead sets listed in the IFU with the
  HeartStart Intrepid. Failure to do so may introduce noise and result in intermittent 'Cannot Analyze' or
  'Leads on/Leads off' ECG messages.
- Use only Philips monitoring electrodes, multifunction electrode pads, battery, and accessories listed in the IFU. Substitutions may cause the HeartStart Intrepid to function improperly and cause patient injury.
- Keep a copy of this Urgent Field Safety Notification letter with your device's Instructions for Use until
  you receive the correction.
- Complete and return the Urgent Field Safety Notice Response Form included with this letter.

Complete and return the Urgent Field Safety Notification response form included within 30 days of receipt. We acknowledge receipt and understanding of the accompanying Field Safety Notification and confirm that the information from this Notification has been properly distributed to all users that handle the HeartStart Intrepid devices.

Name of person completi	ng this f	orm:				
Signature:			 	 	 	
Printed Name:						
Title:						
Telephone Number:						
Email Address:						
Date (DD-MMM-YYYY):				 		

Please return this form to Philips by email or fax < Key Market Insert reply information >